



Operating instructions

**RI FB Inside/i
RI MOD/i CC CANopen**



DE | Bedienungsanleitung

EN-US | Operating instructions



42,0410,1913

035-25042022

Inhaltsverzeichnis

Allgemeines	4
Sicherheit	4
Anschlüsse und Anzeigen	4
Eigenschaften der Datenübertragung	5
Konfigurationsparameter	5
Roboter-Interface konfigurieren	6
Funktion DIP Schalter	6
Konfiguration der Prozessdaten-Breite	6
Knotenadresse einstellen mit DIP-Schalter(Beispiel)	6
Knotenadresse einstellen	8
Die Webseite der Stromquelle	8
SmartManager der Stromquelle aufrufen und anmelden	8
Ein- und Ausgangssignale	10
Datentypen	10
Verfügbarkeit der Eingangssignale	10
Eingangssignale (vom Roboter zur Stromquelle)	10
Wertebereich Working mode	15
Wertebereich Processline selection	15
Wertebereich TWIN mode	16
Wertebereich Documentation mode	16
Wertebereich Process controlled correction	16
Verfügbarkeit der Ausgangssignale	17
Ausgangssignale (von der Stromquelle zum Roboter)	17
Zuordnung Sensorstatus 1-4	20
Wertebereich Safety status	20
Wertebereich Process Bit	21
Ein- und Ausgangssignale Retrofit Image	22
Eingangssignale (vom Roboter zur Stromquelle)	22
Wertebereich Betriebsarten	23
Ausgangssignale (vom der Stromquelle zum Roboter)	23

Allgemeines

Sicherheit




WARNING!

Fehlbedienung und fehlerhaft durchgeführte Arbeiten können schwerwiegende Personen- und Sachschäden verursachen.

Alle in diesem Dokument beschriebenen Arbeiten und Funktionen dürfen nur von geschultem Fachpersonal ausgeführt werden, wenn folgende Dokumente vollständig gelesen und verstanden wurden:

- ▶ dieses Dokument
- ▶ die Bedienungsanleitung des Roboterinterface "RI FB Inside/i"
- ▶ sämtliche Dokumente der Systemkomponenten, insbesondere Sicherheitsvorschriften

Anschlüsse und Anzeigen

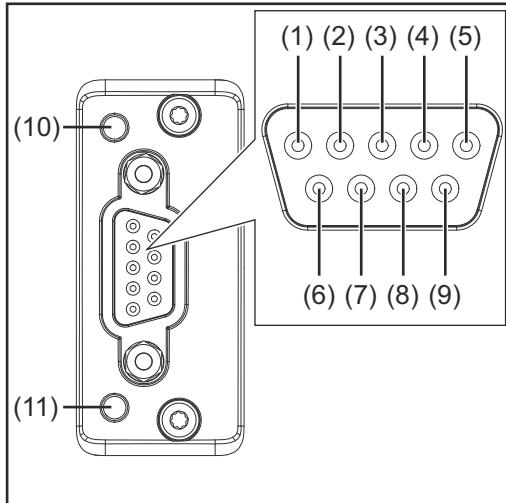

CANopen Anschluss	
(1)	-
(2)	CAN_L
(3)	CAN_GND
(4)	-
(5)	CAN_SHD
(6)	-
(7)	CAN_H
(8)	-
(9)	-
Gehäuse	CAN_SHIELD

Anzeigen

(10)	LED ERR (Fehler)
(11)	LED RUN (Betrieb)

LED ERR (Fehler)

Status	Bedeutung
Aus	keine Fehler (oder keine Versorgungsspannung)
Blinkt rot	Limit für Warnung erreicht Ein Fehlerzähler hat das Limit für eine Warnung erreicht oder überschritten
Flackert rot	LSS Dienst läuft
Blinkt rot (zweimal)	Kontrollfehler Ein „Guard-“ (NMT-Slave oder NMT-Master) oder „Heartbeat“ (Heartbeat consumer) Fehler ist aufgetreten
Leuchtet rot	Keine Kommunikation (fataler Fehler)

LED RUN (Betrieb)	
Status	Bedeutung
Aus	keine Versorgungsspannung
Leuchtet grün	Modul im Status 'operational'
Blinkt grün	Modul im Status 'pre-operational'
Blinkt grün (kurz)	Modul im Status 'stopped'
Flackert grün	Erkennung der Übertragungs-Geschwindigkeit läuft
Leuchtet rot	Wenn die LED Run und die LED Error rot leuchten zeigt das ein schwerwiegendes Ereignis an, welches das Interface in einen Ausnahmezustand bringt. → Servicedienst kontaktieren

Eigenschaften der Datenübertragung

Netzwerk Topologie

Linearer Bus, Busabschluss an beiden Enden (121 Ohm), Stichleitungen vermeiden

Medium und maximale Buslänge

Bei der Auswahl der Kabel, Stecker und Abschluss-Widerstände sind die ISO11898-2 und die CANopen Empfehlung CiA 303 "Cabling and connector pin assignment" zu beachten.

Anzahl der Stationen

max. 64 Teilnehmer

Übertragungs-Geschwindigkeit

1MBit/s, 500 kBit/s, 250 kBit/s, 125 kBit/s, 100 kBits/s, 50 kBits/s, 20 kBits/s, 10 kBits/s

Prozessdaten-Breite

konfigurierbar am Roboter-Interface RI FB Inside/i
siehe nachfolgenden Abschnitt „Roboter-Interface konfigurieren“


Konfigurationsparameter

Bei einigen Roboter-Steuerungen kann es erforderlich sein die hier beschriebenen Konfigurationsparameter anzugeben, damit das Busmodul mit dem Roboter kommunizieren kann.

Parameter	Wert	Beschreibung
Vendor ID	0000 02C1 _{hex} (705 _{dez})	Fronius International GmbH
Product Code	0000 0301 _{hex} (769 _{dez})	Fronius FB Inside CANopen
Device Name		Fronius-Inside-CANopen

Roboter-Interface konfigurieren

Funktion DIP Schalter

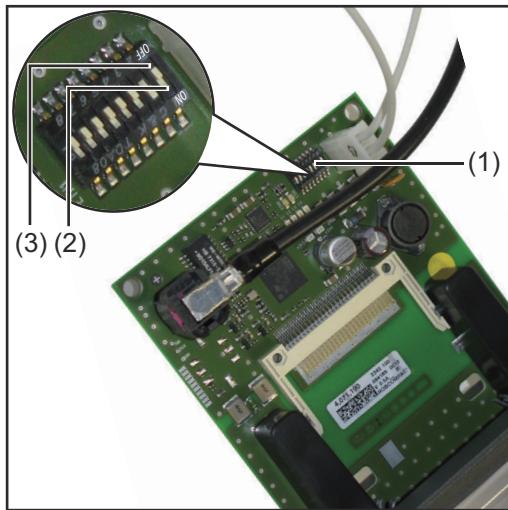

Der DIP-Schalter (1) am Roboter-Interface RI FB Inside/i dient zur Einstellung

- der Prozessdaten-Breite
- der Knotenadresse / IP-Adresse

Werksseitig sind alle Positionen des DIP-Schalters in der Stellung OFF (3). Das entspricht dem binären Wert 0.

Die Stellung ON (2) entspricht dem binären Wert 1.

Konfiguration der Prozessdaten-Breite

DIP-Schalter									Konfiguration
8	7	6	5	4	3	2	1		
OFF	OFF	-	-	-	-	-	-		Standard Image 320 Bit
OFF	ON	-	-	-	-	-	-		Economy Image 128 Bit
ON	OFF	-	-	-	-	-	-		Retro Fit Umfang abhängig von Busmodul
ON	ON	-	-	-	-	-	-		Nicht verwendet

Über die Prozessdaten-Breite wird der Umfang der übertragenen Datenmenge definiert.

Welche Datenmenge übertragen werden kann ist abhängig von

- der Roboter-Steuerung
- der Anzahl der Stromquellen
- der Art der Stromquellen
 - „Intelligent Revolution“
 - „Digital Revolution“ (Retro Fit)

Knotenadresse einstellen mit DIP-Schalter (Beispiel)

DIP-Schalter									Knotenadresse
8	7	6	5	4	3	2	1		
-	-	OFF	OFF	OFF	OFF	OFF	ON		1
-	-	OFF	OFF	OFF	OFF	ON	OFF		2
-	-	OFF	OFF	OFF	OFF	ON	ON		3
-	-	ON	ON	ON	ON	ON	OFF		62

Die Knotenadresse wird mit den Positionen 1 bis 6 des DIP-Schalters eingestellt. Die Einstellung erfolgt im Binärformat. Das ergibt einen Einstellbereich von 1 bis 63 im Dezimalformat.

HINWEIS!

Nach jeder Änderung der DIP-Schalter Einstellungen ist ein Neustart des Interface durchzuführen damit die Änderungen wirksam werden.

(Neustart = Unterbrechen und Wiederherstellen der Spannungsversorgung oder Ausführen der entsprechenden Funktion im SmartManager)

Knotenadresse einstellen

Bei Auslieferung ist die Knotenadresse 0 eingestellt. Die Knotenadresse kann auf 2 Arten eingestellt werden:

- Knotenadressen im Bereich von 1 bis 63 können mit dem DIP-Schalter eingestellt werden.
- Wird am DIP-Schalter die Knotenadresse 0 belassen, können Knotenadressen im Bereich von 1 bis 127 nur über folgende Konfigurations-Tools eingestellt werden:
 - SmartManager

HINWEIS!

Wird die KnotenAdresse mit dem DIP-Schalter wieder größer 0 gesetzt, ist nach dem nächsten Neustart des Roboter-Interface die entsprechende KnotenAdresse im Bereich 1 bis 63 eingestellt.

Eine zuvor von einem Konfigurations-Tool eingestellte Knotenadresse wird überschrieben.

HINWEIS!

Wurden bereits Einstellungen vorgenommen gibt es 2 Arten um alle Netzwerk-Einstellungen auf Auslieferungszustand zurückzusetzen:

- Alle DIP-Schalter wieder auf 0 setzen und Interface neu starten oder
- Mit dem Button Restore factory settings im SmartManager


Die Webseite der Stromquelle

Die Stromquelle verfügt über eine eigene Webseite, den SmartManager. Sobald die Stromquelle in einem Netzwerk integriert ist, kann der SmartManager über die IP-Adresse der Stromquelle aufgerufen werden.

Abhängig von Anlagenkonfiguration und Software-Erweiterungen enthält der SmartManager folgende Einträge:

- Übersicht
- Update
- Screenshot
- Sichern & Wiederherstellen
- Funktionspakete
- Job-Daten
- Kennlinienübersicht
- RI FB INSIDE/i

SmartManager der Stromquelle aufrufen und anmelden

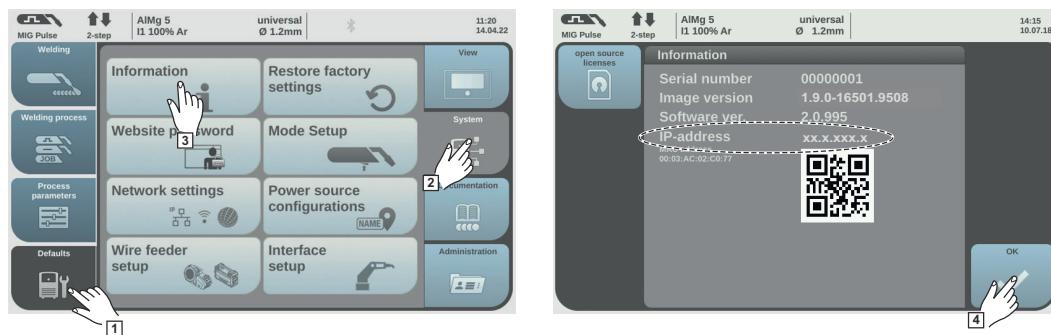

1 Voreinstellungen / System / Information ==> IP-Adresse der Stromquelle notieren

2 IP-Adresse im Suchfeld des Browsers eingeben

3 Benutzername und Kennwort eingeben

Werkseinstellung:

Benutzername = admin

Kennwort = admin

4 Angezeigten Hinweis bestätigen

Der SmartManager der Stromquelle wird angezeigt.

Ein- und Ausgangssignale

Datentypen	Folgende Datentypen werden verwendet: - UINT16 (Unsigned Integer) Ganzzahl im Bereich von 0 bis 65535 - SINT16 (Signed Integer) Ganzzahl im Bereich von -32768 bis 32767
Umrechnungsbeispiele:	<ul style="list-style-type: none">- für positiven Wert (SINT16) z.B. gewünschter Drahtvorschub x Faktor $12.3 \text{ m/min} \times 100 = 1230_{\text{dez}} = 04CE_{\text{hex}}$- für negativen Wert (SINT16) z.B. gewünschte Lichtbogen-Korrektur x Faktor $-6.4 \times 10 = -64_{\text{dez}} = FFC0_{\text{hex}}$
Verfügbarkeit der Eingangssignale	Die nachfolgend angeführten Eingangssignale sind ab Firmware V2.3.0 bei allen Inside/i-Systemen verfügbar.

Eingangssignale (vom Roboter zur Stromquelle)

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut						Standard	Economy		
WORD	BYTE	BIT	BIT								
0	0	0	0	Welding Start	steigend			Siehe Tabelle Wertebereich Working mode auf Seite 15			
		1	1	Robot ready	High						
		2	2	Working mode Bit 0	High						
		3	3	Working mode Bit 1	High						
		4	4	Working mode Bit 2	High						
		5	5	Working mode Bit 3	High						
		6	6	Working mode Bit 4	High						
		7	7	—							
0	1	0	8	Gas on	steigend			✓	✓		
		1	9	Wire forward	steigend						
		2	10	Wire backward	steigend						
		3	11	Error quit	steigend						
		4	12	Touch sensing	High						
		5	13	Torch blow out	steigend						
		6	14	Processline selection Bit 0	High	Siehe Tabelle Wertebereich Processline selection auf Seite 15					
		7	15	Processline selection Bit 1	High						
2	1	0	16	Welding Simulation	High			✓	✓		
		1	17	Synchro pulse on	High						
		2	18	—							
		3	19	—							
		4	20	—							
		5	21	—							
		6	22	Wire brake on	High						
		7	23	Torchbody Xchange	High						
1	3	0	24	—				✓	✓		
		1	25	Teach mode	High						
		2	26	—							
		3	27	—							
		4	28	—							
		5	29	Wire sense start	steigend						
		6	30	Wire sense break	steigend						
		7	31	—							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image				
relativ		absolut						Standard	Economy			
WORD	BYTE	BIT	BIT									
2	4	0	32	TWIN mode Bit 0	High	Siehe Tabelle Wertebereich TWIN mode auf Seite 16	✓	✓				
		1	33	TWIN mode Bit 1	High							
		2	34	—								
		3	35	—								
		4	36	—								
	5	5	37	Documentation mode	High	Siehe Tabelle Wertebereich Documentation mode auf Seite 16						
		6	38	—								
		7	39	—								
		0	40	—								
		1	41	—								
		2	42	—								
		3	43	—								
		4	44	—								
		5	45	—								
		6	46	—								
		7	47	Disable process controlled correction	High							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
7	4	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8	0-7	64-71	Welding characteristic- / Job number	UINT16	0 bis 1000	1	✓	✓
	9	0-7	72-79						
5	10, 11	0-7	80-95	Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG LSC, CMT, ConstantWire: Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
				Beim Job-Betrieb: Power correction		SINT16	-20,00 bis 20,00 [%]	100	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
6	12, 13	0-7	96-111	Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Arclength correction	SINT16	-10,0 bis 100,0 [m/min]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Welding voltage	UINT16	0,0 bis 6553,5 [V]	10		
				Beim Job-Betrieb: Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren ConstantWire: Hotwire current	UINT16	0,0 bis 6553,5 [A]	10		
				Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Pulse-/dynamic correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
7	14, 15	0-7	112-127	Beim Schweißverfahren MIG/MAG Standard-Manuell: Dynamic	UINT16	0,0 bis 10,0 [Schritte]	10	✓	✓
				Wire retract correction	UINT16	0,0 bis 10,0 [Schritte]	10		
8	16	0-7	128-135	Welding speed	UINT16	0,0 bis 1000,0 [cm/min]	10	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Process controlled correction	UINT16	Siehe Tabelle Wertebereich Process control-led correction auf Seite 16	10	✓	
	19	0-7	152-159						
10	20	0-7	160-167					✓	
	21	0-7	168-175						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	BIT					Standard	Economy
11	22	0-7	176-183	—				✓	
	23	0-7	184-191						
12	24	0-7	192-199	—				✓	
	25	0-7	200-207						
13	26	0-7	208-215	—				✓	
	27	0-7	216-223						
14	28	0-7	224-231	—				✓	
	29	0-7	232-239						
15	30	0-7	240-247	Wire forward / backward length	UINT16	OFF / 1 bis 65535 [mm]	1	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire sense edge detection	UINT16	OFF / 0,5 bis 20,0 [mm]	10	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—				✓	
	35	0-7	280-287						
18	36	0-7	288-295	—				✓	
	37	0-7	296-303						
19	38	0-7	304-311	Seam number	UINT16	0 bis 65535	1	✓	
	39	0-7	312-319						

**Wertebereich
Working mode**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	Parameteranwahl intern
0	0	0	0	1	Kennlinien Betrieb Sonder 2-Takt
0	0	0	1	0	Job-Betrieb
0	1	0	0	0	Kennlinien Betrieb 2-Takt
0	1	0	0	1	MIG/MAG Standard-Manuell 2-Takt
1	0	0	0	1	Kühlmittel-Pumpe stoppen

Wertebereich Betriebsart

**Wertebereich
Processline selection**

Bit 1	Bit 0	Beschreibung
0	0	Prozesslinie 1 (default)
0	1	Prozesslinie 2
1	0	Prozesslinie 3

Bit 1	Bit 0	Beschreibung
1	1	Reserviert

Wertebereich Prozesslinien-Auswahl

**Wertebereich
TWIN mode**

Bit 1	Bit 0	Beschreibung
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserve

Wertebereich TWIN-Betriebsart

**Wertebereich
Documentation
mode**

Bit 0	Beschreibung
0	Nahtnummer von Stromquelle (intern)
1	Nahtnummer von Roboter (Word 19)

Wertebereich Dokumentationsmodus

**Wertebereich
Process control-
led correction**

Prozess	Signal	Aktivität / Datentyp	Wertebereich Einstellbereich	Einheit	Faktor
PMC	Arc length stabili- zer	SINT16	-327,8 bis +327,7 0,0 bis +5,0	Volt	10

Wertebereich prozessabhängige Korrektur

Verfügbarkeit der Ausgangssignale	Die nachfolgenden angeführten Ausgangssignale sind ab Firmware V2.3.0 bei allen Inside/i-Systemen verfügbar.
--	--

**Ausgangssignale
(von der Stromquelle zum Roboter)**

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz			
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
0	1	0	8	Collisionbox active	Low	O = Kollision oder Kabelbruch		✓	✓
		1	9	Robot Motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	—					
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection internally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	—							
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	Siehe Tabelle Zuordnung Sensorstatus 1-4 auf Seite 20					
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	—							
		1	33	—							
		2	34	—							
		3	35	Safety status Bit 0	High	Siehe Tabelle Wertebereich Safety status auf Seite 20					
		4	36	Safety status Bit 1	High						
	5	5	37	—							
		6	38	Notification	High						
		7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	—							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	absolut						
6	3	0	48	Process Bit 0	High	Siehe Tabelle Wer-tebereich Process Bit auf Seite 21		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High	✓	✓		
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8	0-7	64-71	Welding voltage	UINT16	0,0 bis 655,35 [V]	100	✓	✓
	9	0-7	72-79						
5	10	0-7	80-87	Welding current	UINT16	0,0 bis 6553,5 [A]	10	✓	✓
	11	0-7	88-95						
6	12	0-7	96-103	Wire feed speed	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
	13	0-7	104-111						
7	14	0-7	112-119	Actual real value for seam tracking	UINT16	0 bis 6,5535	10000	✓	✓
	15	0-7	120-127						
8	16	0-7	128-135	Error number	UINT16	0 bis 65535	1	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Warning number	UINT16	0 bis 65535	1	✓	
	19	0-7	152-159						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
10	20	0-7	160-167	Motor current M1	SINT16	-327,68 bis 327,67 [A]	100	✓	
	21	0-7	168-175						
11	22	0-7	176-183	Motor current M2	SINT16	-327,68 bis 327,67 [A]	100	✓	
	23	0-7	184-191						
12	24	0-7	192-199	Motor current M3	SINT16	-327,68 bis 327,67 [A]	100	✓	
	25	0-7	200-207						
13	26	0-7	208-215	—	—	—	—	✓	
	27	0-7	216-223						
14	28	0-7	224-231	—	—	—	—	✓	
	29	0-7	232-239						
15	30	0-7	240-247	—	—	—	—	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire position	SINT16	-327,68 bis 327,67 [mm]	100	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—	—	—	—	✓	
	35	0-7	280-287						
18	36	0-7	288-295	—	—	—	—	✓	
	37	0-7	296-303						
19	38	0-7	304-311	—	—	—	—	✓	
	39	0-7	312-319						

Zuordnung Sensorstatus 1-4

Signal	Beschreibung
Sensor status 1	OPT/i WF R Drahtende (4,100,869)
Sensor status 2	OPT/i WF R Drahtfass (4,100,879)
Sensor status 3	OPT/i WF R Ringsensor (4,100,878)
Sensor status 4	Drahtpufferset CMT TPS/i (4,001,763)

Wertebereich Safety status

Bit 1	Bit 0	Beschreibung
0	0	Reserve
0	1	Halt
1	0	Stopp

Bit 1	Bit 0	Beschreibung
1	1	Nicht eingebaut / aktiv

**Wertebereich
Process Bit**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	kein Prozess oder Parameteranwahl intern
0	0	0	0	1	MIG/MAG Puls-Synergic
0	0	0	1	0	MIG/MAG Standard-Synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG Standard-Manuell
0	0	1	1	0	Elektrode
0	0	1	1	1	WIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire

Ein- und Ausgangssignale Retrofit Image

Eingangssignale (vom Roboter zur Stromquelle)

Die nachfolgend angeführten Signale sind ab Firmware V1.8.5 bei allen Inside/i-Systemen verfügbar.

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
E01	Schweißen ein		High
E02	Roboter bereit		High
E03	Betriebsarten Bit 0	Siehe Tabelle Wertebereich Betriebsarten auf Seite 23	High
E04	Betriebsarten Bit 1		High
E05	Betriebsarten Bit 2		High
E06	—		
E07	—		
E08	—		
E09	Gas Test		High
E10	Drahtvorlauf		High
E11	Drahtrücklauf		High
E12	Error quit		High
E13	Positionssuchen		High
E14	Brenner ausblasen		High
E15	—		
E16	—		
E17 - E24	Job-Nummer	0 bis 99	
E25 - E31	Programmnummer	1 bis 127	
E32	Schweißsimulation		High
nur in Betriebsart Job-Betrieb			
E17 - E31	Job-Nummer	0 bis 999	
E32	Schweißsimulation		High
E33 - E40	Leistungs-Sollwert - Low Byte	0 bis 65535 (0 bis 100 %)	
E41 - E48	Leistungs-Sollwert - High Byte		
E49 - E56	Lichtbogen-Längenkorrektur, Sollwert Low Byte	0 bis 65535 (-30 bis +30 %)	
E57 - E64	Lichtbogen-Längenkorrektur, Sollwert High Byte		
E65 - E72	—		
E73 - E80	Puls- oder Dynamikkorrektur	0 bis 255 (-5 bis +5 %)	
E81 - E88	—		
E89 - E96	—		

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
E97	Synchro Puls ein		High
E98 - E100	—		
E101	Leistungs-Vollbereich (0 bis 30 m)		High
E102 - E112	—		

Wertebereich Betriebsarten

Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	MIG/MAG Synergic Schweißen
0	0	1	MIG/MAG Synergic Schweißen
0	1	0	Job-Betrieb
0	1	1	Parameteranwahl intern

Ausgangssignale (vom der Stromquelle zum Roboter)

Die nachfolgend angeführten Signale sind ab Firmware V1.8.5 bei allen Inside/i-Systemen verfügbar.

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
A01	Lichtbogen stabil		High
A02	Limitsignal		High
A03	Prozess aktiv		High
A04	Hauptstrom-Signal		High
A05	Brenner-Kollisionsschutz		High
A06	Stromquelle bereit		High
A07	Kommunikation bereit		High
A08	—		
A09 - A16	—		
A17 - A24	—		
A25	—		
A26	—		
A27	—		
A28	Draht vorhanden		High
A29	Überschreitung Kurzschlusszeit		High
A30	—		
A31	—		
A32	Leistung außerhalb Bereich		High

Lfd.Nr	Signalbezeichnung	Bereich	Aktivität
A33 - A40	Schweißspannungs-Istwert - Low Byte	0 bis 65535 (0 bis 100 V)	
A41 - A48	Schweißspannungs-Istwert - High Byte		
A49 - A56	Schweißstrom-Istwert - Low Byte	0 bis 65535 (0 bis 1000 A)	
A57 - A64	Schweißstrom-Istwert - High Byte		
A65 - A72	Motorstrom-Istwert	0 bis 255 (0 bis 5 A)	
A73 - A80	—		
A81 - A88	—		
A89 - A96	—		
A97 - A104	Drahtgeschwindigkeit - Low Byte	0 bis vDmax	
A105 - A112	Drahtgeschwindigkeit - High Byte		

Table of contents

General.....	26
Safety	26
Connections and Indicators.....	26
Data Transfer Properties.....	27
Configuration Parameters.....	27
Configuration of robot interface.....	28
Dip switch function.....	28
Configuration of the process data width	28
Set node address with dip switch(example).....	28
Configuring the Node Address.....	30
The Website of the Power Source	30
Opening and Logging into the SmartManager for the Power Source.....	30
Input and output signals.....	32
Data types	32
Availability of Input Signals.....	32
Input Signals (From Robot to Power Source).....	32
Value Range for Working Mode	38
Value range Process line selection	38
Value Range for TWIN Mode.....	39
Value Range for Documentation Mode.....	39
Value range for Process controlled correction.....	39
Availability of Output Signals.....	40
Output Signals (from Power Source to Robot)	40
Assignment of Sensor Statuses 1–4	43
Value range Safety status.....	43
Value Range for Process Bit.....	44
Retrofit Image Input and Output Signals	45
Input Signals (from Robot to Power Source).....	45
Value range Operating modes.....	46
Output Signals (from Power Source to Robot)	46

General

Safety




WARNING!

Incorrect operation and faulty work can cause serious personal injury and material damage.

All work and functions described in this document must be performed only by trained specialist personnel who have read and understood the following documents in full:

- ▶ this document
- ▶ the Operating Instructions of the robot interface "RI FB Inside/i"
- ▶ all documents relating to system components, especially the safety rules

Connections and Indicators

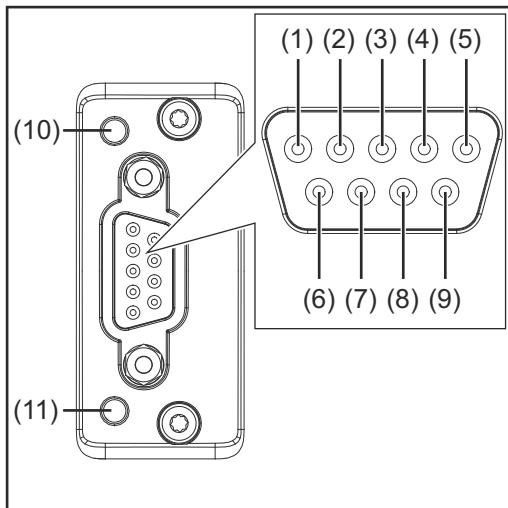

CANopen connection	
(1)	-
(2)	CAN_L
(3)	CAN_GND
(4)	-
(5)	CAN_SHD
(6)	-
(7)	CAN_H
(8)	-
(9)	-
Housing	CAN_SHIELD

Indicators

(10)	LED ERR (error)
(11)	LED RUN (operation)

LED ERR (error)

Status	Meaning
Off	No error (or no supply voltage)
Flashes red	Limit for warning reached An error counter has reached or exceeded the limit for a warning
Flickers red	LSS service running
Flashes red (twice)	Control error A „Guard-“ (NMT-Slave oder NMT-Master) or „Heartbeat“ (Heartbeat consumer) error has occurred
Lights up red	No communication (fatal error)

LED RUN (operation)	
Status	Meaning
Off	No supply voltage
Lights up green	Module in 'operational' status
Flashes green	Module in 'pre-operational' status
Flashes green (briefly)	Module in 'stopped' status
Flickers green	Transmission speed detection is running
Lights up red	If the Run LED and Error LED light up red, this indicates a serious event which places the interface in an exception state. → Contact the service team

Data Transfer Properties

Network topology

Linear bus, bus termination on both ends (121 Ohm), avoid stub cables

Medium and maximum bus length

When selecting cable, plug, and terminating resistors, ISO11898-2 and the CANopen recommendation CiA 303 "Cabling and connector pin assignment" must be observed.

Number of stations

Max. 64 participants

Transmission speed

1MBit/s, 500 kBit/s, 250 kBit/s, 125 kBit/s, 100 kBits/s, 50 kBits/s, 20 kBits/s, 10 kBits/s

Process data width

Can be configured in the RI FB Inside/i robot interface
see following section "Configuration of robot interface"


Configuration Parameters

In some robot control systems, it may be necessary to state the configuration parameters described here so that the bus module can communicate with the robot.

Parameter	Value	Description
Vendor ID	0000 02C1 _{hex} (705 _{dec})	Fronius International GmbH
Product Code	0000 0301 _{hex} (769 _{dec})	Fronius FB Inside CANopen
Device name		Fronius-Inside-CANopen

Configuration of robot interface

Dip switch function

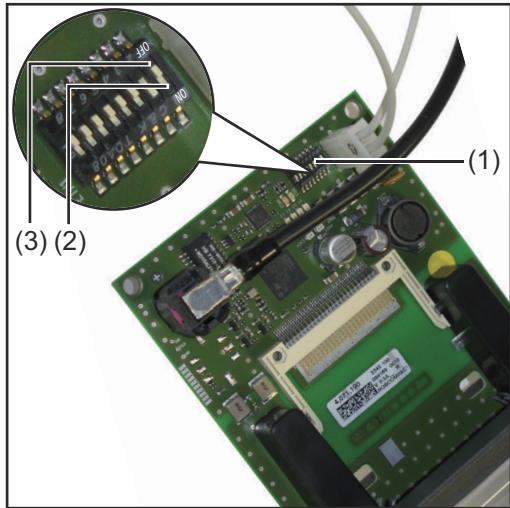

The dip switch (1) on the robot interface RI FB Inside/i is used to configure
 - the process data width
 - the node address/IP address

At the factory all positions of the dip switch are set to OFF (3).
 This corresponds to the binary value 0.

The position (2) corresponds to the binary value 1.

Configuration of the process data width

Dip switch								Configuration
8	7	6	5	4	3	2	1	
OFF	OFF	-	-	-	-	-	-	Standard image 320 Bit
OFF	ON	-	-	-	-	-	-	Economy image 128 Bit
ON	OFF	-	-	-	-	-	-	Retro Fit Scope dependent on bus module
ON	ON	-	-	-	-	-	-	Not used

The process data width defines the scope of the transferred data volume.

The kind of data volume that can be transferred depends on

- the robot controls
- the number of power sources
- the type of power sources
 - "Intelligent Revolution"
 - "Digital Revolution" (Retro Fit)

Set node address with dip switch (example)

Dip Switch								Node address
8	7	6	5	4	3	2	1	
-	-	OFF	OFF	OFF	OFF	OFF	ON	1
-	-	OFF	OFF	OFF	OFF	ON	OFF	2
-	-	OFF	OFF	OFF	OFF	ON	ON	3
-	-	ON	ON	ON	ON	ON	OFF	62

The node address is set with positions 1 to 6 of the dip switch.

The configuration is carried out in binary format. This results in a configuration range of 1 to 63 in decimal format.

NOTE!

Whenever changes are made to the DIP switch settings, the interface must be restarted in order for the changes to take effect.

(Restart = interrupting and restoring the power supply or executing the corresponding function in SmartManager)

Configuring the Node Address

Upon delivery the configured node address is 0. The node address can be configured in two ways:

- Node addresses in the range of 1 to 63 can be configured with the dip switch.
- If node address 0 is kept on the dip switch, the node addresses in the range of 1 to 127 can only be configured with the following configuration tools:
 - SmartManager

NOTE!

If the node address is set to higher than 0 with the dip switch, the relevant node address will be configured to the range of 1 to 63 after restarting the robot interface.

A node address previously configured by a configuration tool is overwritten.

NOTE!

If configurations have already been made, the network configurations can be restored to factory settings in two ways:

- set all dip switches back to 0 and restart interface
or
- using the Restore factory settings button in SmartManager

The Website of the Power Source


The power source has its own website, the SmartManager.

As soon as the power source has been integrated into a network, the SmartManager can be opened via the IP address of the power source.

Depending on the system configuration and software upgrades, the SmartManager may contain the following entries:

- Overview
- Update
- Screenshot
- Save and restore
- Function packages
- Job data
- Overview of characteristics
- RI FB INSIDE/i

Opening and Logging into the SmartManager for the Power Source

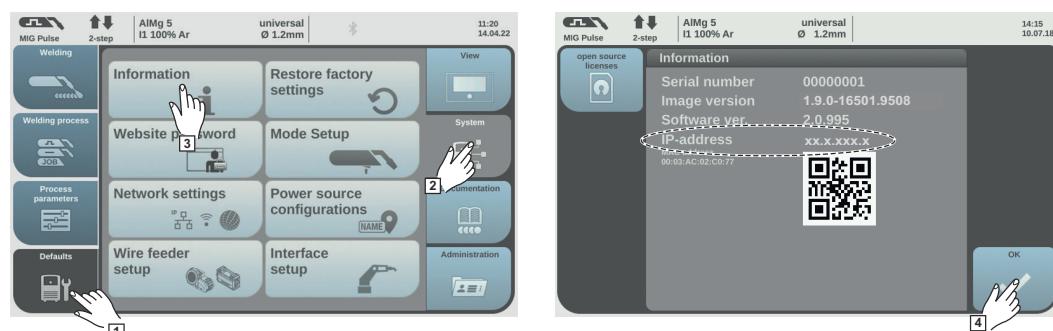

[1] Presettings/System/Information ==> note down IP address of power source

[2] Enter the IP address into the search field of the browser

3 Enter username and password

Factory setting:
Username = admin
Password = admin

4 Confirm displayed message

The SmartManager of the power source is displayed.

Input and output signals

Data types

The following data types are used:

- **UINT16** (Unsigned Integer)
Whole number in the range from 0 to 65535
- **SINT16** (Signed Integer)
Whole number in the range from -32768 to 32767

Conversion examples:

- for a positive value (SINT16)
e.g. desired wire speed x factor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dec}} = 04CE_{\text{hex}}$
- for a negative value (SINT16)
e.g. arc correction x factor
 $-6.4 \times 10 = -64_{\text{dec}} = FFC0_{\text{hex}}$

Availability of Input Signals

The input signals listed below are available from firmware V2.3.0 for all Inside/i systems.

Input Signals (From Robot to Power Source)

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Welding Start	Increasing			See table Value Range for Working Mode on page 38	✓ ✓
		1	1	Robot ready	High				
		2	2	Working mode Bit 0	High				
		3	3	Working mode Bit 1	High				
		4	4	Working mode Bit 2	High				
		5	5	Working mode Bit 3	High				
		6	6	Working mode Bit 4	High				
		7	7	—					
0	1	0	8	Gas on	Increasing			See table Value range Process line selection on page 38	✓ ✓
		1	9	Wire forward	Increasing				
		2	10	Wire backward	Increasing				
		3	11	Error quit	Increasing				
		4	12	Touch sensing	High				
		5	13	Torch blow out	Increasing				
		6	14	Process line selection Bit 0	High				
		7	15	Process line selection Bit 1	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
2	1	0	16	Welding Simulation	High			✓	✓
		1	17	Synchro pulse on	High				
		2	18	—					
		3	19	—					
		4	20	—					
		5	21	—					
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
1	3	0	24	—				✓	✓
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	Increasing				
		6	30	Wire sense break	Increasing				
		7	31	—					

Address				Signal	Activity / data type	Range	Factor	Process image				
relative		absolute						Standard	Economy			
WORD	BYTE	BIT	BIT									
2	4	0	32	TWIN mode Bit 0	High	See table Value Range for TWIN Mode on page 39	✓	✓				
		1	33	TWIN mode Bit 1	High							
		2	34	—								
		3	35	—								
	5	4	36	—								
		5	37	Documentation mode	High	See table Value Range for Documentation Mode on page 39						
		6	38	—								
		7	39	—								
5	0	0	40	—			✓	✓				
		1	41	—								
		2	42	—								
		3	43	—								
		4	44	—								
		5	45	—								
		6	46	—								
	7	47		Disable process controlled correction	High							

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
7	4	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8	0-7	64-71	Welding characteristic- / Job number	UINT16	0 to 1000	1	✓	✓
	9	0-7	72-79						
5	10, 11	0-7	80-95	<p>With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG standard manual, MIG/MAG PMC, MIG/MAG LSC, CMT, ConstantWire:</p> <p>Wire feed speed command value</p> <p>With the Job mode:</p> <p>Power correction</p>	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓

Address				Signal	Activity / data type	Range	Factor	Process image	
WORD	BYTE	BIT	BIT					Standard	Economy
6	12, 13	0-7	96-111	With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Arclength correction	SINT16	-10.0 to 100.0 [m/min]	10	✓	✓
				With the welding process MIG/MAG standard manual: Welding voltage	UINT16	0.0 to 6553.5 [V]	10		
				With the Job mode: Arclength correction	SINT16	-10.0 to 10.0 [Steps]	10		
				With the welding process ConstantWire: Hotwire current	UINT16	0.0 to 6553.5 [A]	10		
				With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Pulse-/dynamic correction	SINT16	-10.0 to 10.0 [Steps]	10		
7	14, 15	0-7	112-127	With the welding process MIG/MAG standard manual: Dynamic	UINT16	0.0 to 10.0 [Steps]	10	✓	✓
				Wire retract correction	UINT16	0.0 to 10.0 [Steps]	10		
8	16	0-7	128-135	Welding speed	UINT16	0.0 to 1000.0 [cm/min]	10	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Process controlled correction		See table Value range for Process controlled correction on page 39	10	✓	
	19	0-7	152-159						
10	20	0-7	160-167					✓	
	21	0-7	168-175						
11	22	0-7	176-183	—				✓	
	23	0-7	184-191						

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
12	24	0-7	192-199	—				✓	
	25	0-7	200-207						
13	26	0-7	208-215	—				✓	
	27	0-7	216-223						
14	28	0-7	224-231	—				✓	
	29	0-7	232-239						
15	30	0-7	240-247	Wire forward / backward length	UINT16	OFF / 1 to 65535 [mm]	1	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire sense edge detection	UINT16	OFF / 0.5 to 20.0 [mm]	10	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—				✓	
	35	0-7	280-287						
18	36	0-7	288-295	—				✓	
	37	0-7	296-303						
19	38	0-7	304-311	Seam number	UINT16	0 to 65535	1	✓	
	39	0-7	312-319						

Value Range for Working Mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	Internal parameter selection
0	0	0	0	1	Special 2-step mode characteristics
0	0	0	1	0	Job mode
0	1	0	0	0	2-step mode characteristics
0	1	0	0	1	2-step MIG/MAG standard manual
1	0	0	0	1	Stop coolant pump

Value range for operating mode

Value range Process line selection

Bit 1	Bit 0	Description
0	0	Process line 1 (default)
0	1	Process line 2
1	0	Process line 3
1	1	Reserved

Value range for process line selection

Value Range for TWIN Mode

Bit 1	Bit 0	Description
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserved

Value range for TWIN mode

Value Range for Documentation Mode

Bit 0	Description
0	Seam number of power source (internal)
1	Seam number of robot (Word 19)

Value range for documentation mode

Value range for Process controlled correction

Process	Signal	Activity / Data type	Value range configuration range	Unit	Factor
PMC	Arc length stabilizer	SINT16	-327.8 to +327.7 0.0 to +5.0	Volts	10

Value range for process-dependent correction

Availability of Output Signals	The output signals listed below are available from firmware V2.3.0 for all Inside/i systems.
---------------------------------------	--

Output Signals (from Power Source to Robot)

Address				Signal	Activity / data type	Range	Factor	Process image					
relative		absolute						Standard	Economy				
WORD	BYTE	BIT	BIT										
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz		✓	✓				
		1	1	Power source ready	High								
		2	2	Warning	High								
		3	3	Process active	High								
		4	4	Current flow	High								
		5	5	Arc stable- / touch signal	High								
		6	6	Main current signal	High								
		7	7	Touch signal	High								
0	1	0	8	Collisionbox active	Low	O = collision or cable break							
		1	9	Robot Motion Release	High								
		2	10	Wire stick workpiece	High								
		3	11	—									
		4	12	Short circuit contact tip	High								
		5	13	Parameter selection internally	High								
		6	14	Characteristic number valid	High								
		7	15	Torch body gripped	High								

Address				Signal	Activity / data type	Range	Factor	Process image			
relative		absolute						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	—							
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	See table Assignment of Sensor Statuses 1–4 on page 43					
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	—							
		1	33	—							
		2	34	—							
		3	35	Safety status Bit 0	High	See table Value range Safety status on page 43					
		4	36	Safety status Bit 1	High						
		5	37	—							
		6	38	Notification	High						
	5	7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	—							

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	Process Bit 0	High	See table Value Range for Process Bit on page 44		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High			✓	✓
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8	0-7	64-71	Welding voltage	UINT16	0.0 to 655.35 [V]	100	✓	✓
	9	0-7	72-79						
5	10	0-7	80-87	Welding current	UINT16	0.0 to 6553.5 [A]	10	✓	✓
	11	0-7	88-95						
6	12	0-7	96-103	Wire feed speed	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓
	13	0-7	104-111						
7	14	0-7	112-119	Actual real value for seam tracking	UINT16	0 to 6.5535	10000	✓	✓
	15	0-7	120-127						
8	16	0-7	128-135	Error number	UINT16	0 to 65535	1	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Warning number	UINT16	0 to 65535	1	✓	
	19	0-7	152-159						

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
10	20	0-7	160-167	Motor current M1	SINT16	-327.68 to 327.67 [A]	100	✓	
	21	0-7	168-175						
11	22	0-7	176-183	Motor current M2	SINT16	-327.68 to 327.67 [A]	100	✓	
	23	0-7	184-191						
12	24	0-7	192-199	Motor current M3	SINT16	-327.68 to 327.67 [A]	100	✓	
	25	0-7	200-207						
13	26	0-7	208-215	—				✓	
	27	0-7	216-223						
14	28	0-7	224-231	—				✓	
	29	0-7	232-239						
15	30	0-7	240-247	—				✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire position	SINT16	-327.68 to 327.67 [mm]	100	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—				✓	
	35	0-7	280-287						
18	36	0-7	288-295	—				✓	
	37	0-7	296-303						
19	38	0-7	304-311	—				✓	
	39	0-7	312-319						

Assignment of Sensor Statuses 1–4

Signal	Description
Sensor status 1	OPT/i WF R wire end (4,100,869)
Sensor status 2	OPT/i WF R wire drum (4,100,879)
Sensor status 3	OPT/i WF R ring sensor (4,100,878)
Sensor status 4	Wire buffer set CMT TPS/i (4,001,763)

Value range Safety status

Bit 1	Bit 0	Description
0	0	Reserve
0	1	Hold
1	0	Stop
1	1	Not installed / active

Value Range for Process Bit

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	No internal parameter selection or process
0	0	0	0	1	MIG/MAG pulse synergic
0	0	0	1	0	MIG/MAG standard synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG standard manual
0	0	1	1	0	Electrode
0	0	1	1	1	TIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire

Retrofit Image Input and Output Signals

Input Signals (from Robot to Power Source)

The signals listed below are available from firmware V1.8.5 for all Inside/i systems.

Seq. no	Signal designation	Range	Action
E01	Welding on		High
E02	Robot ready		High
E03	Operating modes bit 0	See table Value range Operating modes on page 46	High
E04	Operating modes bit 1		High
E05	Operating modes bit 2		High
E06	—		
E07	—		
E08	—		
E09	Gas test		High
E10	Wire feed		High
E11	Wire-return		High
E12	Error quit		High
E13	Position searches		High
E14	Purge the welding torch		High
E15	—		
E16	—		
E17 - E24	Job number	0 to 99	
E25 - E31	Program number	1 to 127	
E32	Welding simulation		High
Only in Job mode operating mode			
E17 - E31	Job number	0 to 999	
E32	Welding simulation		High
E33 - E40	Set power value - Low byte	0 to 65535 (0 to 100%)	
E41 - E48	Set power value - High byte		
E49 - E56	Arc length correction, set value Low byte	0 to 65535 (-30 to +30%)	
E57 - E64	Arc length correction, set value High byte		
E65 - E72	—		
E73 - E80	Pulse or dynamic correction	0 to 255 (-5 to +5%)	
E81 - E88	—		
E89 - E96	—		
E97	SynchroPulse on		High

Seq. no	Signal designation	Range	Action
E98 - E100	—		
E101	Full power range (0 to 30 m)		High
E102 - E112	—		

Value range Operating modes

Bit 2	Bit 1	Bit 0	Description
0	0	0	MIG/MAG Synergic welding
0	0	1	MIG/MAG Synergic welding
0	1	0	Job mode
0	1	1	Internal parameter selection

**Output Signals
(from Power Source to Robot)**

The signals listed below are available from firmware V1.8.5 for all Inside/i systems.

Seq. no	Signal designation	Range	Action
A01	Arc stable		High
A02	Limit signal		High
A03	Process active		High
A04	Main current signal		High
A05	Welding torch collision protection		High
A06	Power source ready		High
A07	Communication ready		High
A08	—		
A09 - A16	—		
A17 - A24	—		
A25	—		
A26	—		
A27	—		
A28	Wire present		High
A29	Short circuit time exceeded		High
A30	—		
A31	—		
A32	Power out of range		High
A33 - A40	Welding voltage actual value - Low byte	0 to 65535 (0 to 100 V)	
A41 - A48	Welding voltage actual value - High byte		

Seq. no	Signal designation	Range	Action
A49 - A56	Welding current actual value - Low byte	0 to 65535 (0 to 1000 A)	
A57 - A64	Welding current actual value - High byte		
A65 - A72	Motor current actual value	0 to 255 (0 to 5 A)	
A73 - A80	—		
A81 - A88	—		
A89 - A96	—		
A97 - A104	Wire speed - Low byte	0 to vDmax	
A105 - A112	Wire speed - High byte		



 SPAREPARTS
ONLINE

Fronius International GmbH
Froniusstraße 1
4643 Pettenbach
Austria
contact@fronius.com
www.fronius.com

Under www.fronius.com/contact you will find the addresses
of all Fronius Sales & Service Partners and locations.