



Operating Instructions

**RI FB Inside/i
RI MOD/i CC-M40 Powerlink**



DE | Bedienungsanleitung

EN-US | Operating instructions



42,0410,1919

017-13092022

Inhaltsverzeichnis

Allgemeines	4
Sicherheit	4
Anschlüsse und Anzeigen	4
Eigenschaften der Datenübertragung	5
Konfigurationsparameter	6
Roboter-Interface konfigurieren	7
Funktion DIP Schalter	7
Konfiguration der Prozessdaten-Breite	7
Knotenadresse einstellen mit DIP-Schalter(Beispiel)	7
Knotenadresse einstellen	9
Die Webseite der Stromquelle	9
SmartManager der Stromquelle aufrufen und anmelden	9
Ein- und Ausgangssignale	11
Datentypen	11
Verfügbarkeit der Eingangssignale	11
Eingangssignale (vom Roboter zur Stromquelle)	11
Wertebereich Working mode	16
Wertebereich Processline selection	16
Wertebereich TWIN mode	17
Wertebereich Documentation mode	17
Wertebereich Process controlled correction	17
Verfügbarkeit der Ausgangssignale	18
Ausgangssignale (von der Stromquelle zum Roboter)	18
Zuordnung Sensorstatus 1-4	21
Wertebereich Safety status	21
Wertebereich Process Bit	22

Allgemeines

Sicherheit




WARNING!

Fehlbedienung und fehlerhaft durchgeführte Arbeiten können schwerwiegende Personen- und Sachschäden verursachen.

Alle in diesem Dokument beschriebenen Arbeiten und Funktionen dürfen nur von geschultem Fachpersonal ausgeführt werden, wenn folgende Dokumente vollständig gelesen und verstanden wurden:

- ▶ dieses Dokument
- ▶ die Bedienungsanleitung des Roboterinterface "RI FB Inside/i"
- ▶ sämtliche Dokumente der Systemkomponenten, insbesondere Sicherheitsvorschriften

Anschlüsse und Anzeigen

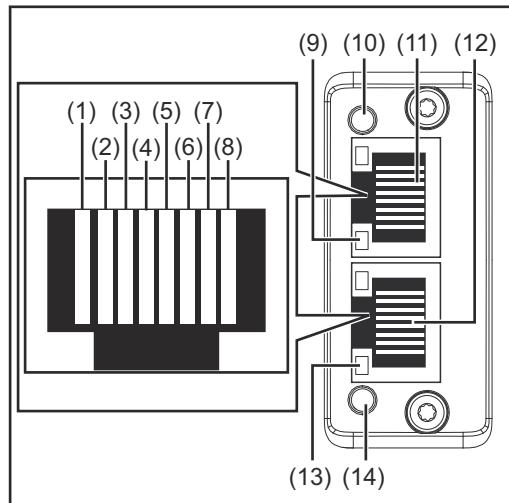

(1)	TX+
(2)	TX-
(3)	RX+
(6)	RX-
(4)	Normalerweise nicht verwendet; um die Signalvollständigkeit sicherzustellen, sind diese Pins miteinander verbunden und enden über einen Filterkreis am Schutzleiter (PE).
(5)	
(7)	
(8)	
(9)	LED Verbindung/Aktivität Anschluss 2
(10)	LED Error (Netzwerkstatus)

(11)	RJ 45 Anschluss 2
(12)	RJ 45 Anschluss 1
(13)	LED Verbindung/Aktivität Anschluss 1
(14)	LED Status (Modulstatus)

LED Status (Modulstatus)	
Status	Bedeutung
Aus	Nicht initialisiert / nicht aktiv
Blinkt schnell grün	NMT_CS_BASIC_ETHERNET kein Datenverkehr
Blinkt grün (1-mal)	NMT_CS_PRE_OPERATIONAL_1 Nur asynchrone Daten
Blinkt grün (2-mal)	NMT_CS_PRE_OPERATIONAL_2 Asynchrone und synchrone Daten. Keine PDO-Daten: Sämtliche Prozessdaten sind ungültig. Empfangene Daten werden ignoriert.

LED Status (Modulstatus)	
Status	Bedeutung
Blinkt grün (3-mal)	NMT_CS_READY_TO_OPERATE Betriebsbereit. Asynchrone und synchrone Daten. Keine PDO-Daten: Sämtliche Prozessdaten sind ungültig. Empfangene Daten werden ignoriert
Leuchtet grün	NMT_CS_OPERATIONAL Normaler Betrieb. Asynchrone und synchrone Daten. PDO-Daten werden empfangen und gesendet
Blinkt langsam grün	NMT_CS_STOPPED Modul gestoppt (beispielsweise für Außerbetriebnahme) Asynchrone und synchrone Daten. Keine PDO-Daten: Sämtliche Prozessdaten sind ungültig. Empfangene Daten werden ignoriert
Leuchtet rot	Ausnahmezustand, schwerer Fehler, ...

LED Error (Netzwerkstatus)	
Status	Bedeutung
Aus	kein Fehler
Leuchtet rot	Ausnahmezustand, schwerer Fehler, ...
Leuchtet	Fehler

LED Verbindung/Aktivität	
Status	Bedeutung
Aus	kein Verbindung
Leuchtet rot	Verbindung hergestellt, kein Datenverkehr
Leuchtet	Verbindung hergestellt, Datenverkehr vorhanden

Eigenschaften der Datenübertragung

Übertragungstechnik

Ethernet

Medium

Bei der Auswahl der Kabel, Stecker und Abschluss-Widerstände ist die Powerlink Montagerichtlinie für die Planung und Installation von Powerlink Systemen zu beachten.

Übertragungs-Geschwindigkeit

100 Mbit/s, Half-Duplex-Mode

Busanschluss

2 x Ethernet Powerlink ports (RJ45)

Application Layer


CANopen

Konfigurationsparameter Bei einigen Roboter-Steuerungen kann es erforderlich sein die hier beschriebenen Konfigurationsparameter anzugeben, damit das Busmodul mit dem Roboter kommunizieren kann.

Parameter	Wert
Vendor-ID	000002C1 _{hex}
Product-Code	0x00010301 _{hex} (Economy Image) 0x00010302 _{hex} (Standard Image)
Manufacture Device Name	Fronius FB-INSIDE-Powerlink

Roboter-Interface konfigurieren

Funktion DIP Schalter

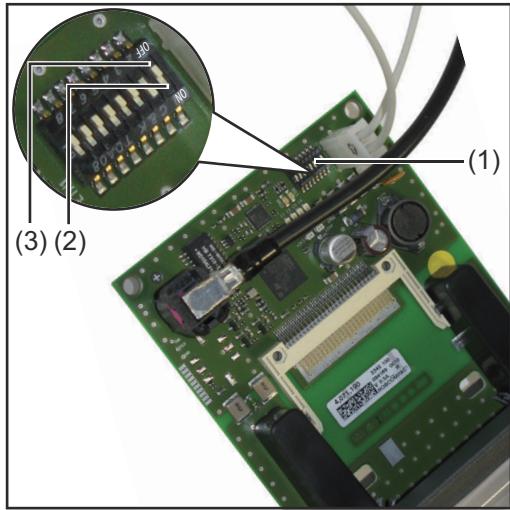

Der DIP-Schalter (1) am Roboter-Interface RI FB Inside/i dient zur Einstellung

- der Prozessdaten-Breite
- der Knotenadresse / IP-Adresse

Werksseitig sind alle Positionen des DIP-Schalters in der Stellung OFF (3). Das entspricht dem binären Wert 0.

Die Stellung ON (2) entspricht dem binären Wert 1.

Konfiguration der Prozessdaten-Breite

DIP-Schalter									Konfiguration
8	7	6	5	4	3	2	1		
OFF	OFF	-	-	-	-	-	-		Standard image 320 Bit
OFF	ON	-	-	-	-	-	-		Economy Image 128 Bit
ON	OFF	-	-	-	-	-	-		Nicht verwendet
ON	ON	-	-	-	-	-	-		Nicht verwendet

Über die Prozessdaten-Breite wird der Umfang der übertragenen Datenmenge definiert.

Welche Datenmenge übertragen werden kann ist abhängig von

- der Roboter-Steuerung
- der Anzahl der Stromquellen

Knotenadresse einstellen mit DIP-Schalter (Beispiel)

DIP-Schalter									Knotenadresse
8	7	6	5	4	3	2	1		
-	-	OFF	OFF	OFF	OFF	OFF	ON		1
-	-	OFF	OFF	OFF	OFF	ON	OFF		2
-	-	OFF	OFF	OFF	OFF	ON	ON		3
-	-	ON	ON	ON	ON	ON	OFF		62
-	-	ON	ON	ON	ON	ON	ON		63

Die Knotenadresse wird mit den Positionen 1 bis 6 des DIP-Schalters eingestellt. Die Einstellung erfolgt im Binärformat. Das ergibt einen Einstellbereich von 1 bis 63 im Dezimalformat

HINWEIS!

Nach jeder Änderung der DIP-Schalter Einstellungen ist ein Neustart des Interface durchzuführen damit die Änderungen wirksam werden.

(Neustart = Unterbrechen und Wiederherstellen der Spannungsversorgung oder Ausführen der entsprechenden Funktion auf der Webseite der Stromquelle)

Knotenadresse einstellen

Bei Auslieferung ist die Knotenadresse 0 eingestellt. Die Knotenadresse kann auf 2 Arten eingestellt werden:

- Knotenadressen im Bereich von 1 bis 63 können mit dem DIP-Schalter eingestellt werden.
- Wird am DIP-Schalter die Knotenadresse 0 belassen, können Knotenadressen im Bereich von 1 bis 125 nur über folgende Konfigurations-Tools eingestellt werden:
 - die Webseite der Stromquelle

HINWEIS!

Wird die Knotenadresse mit dem DIP-Schalter wieder größer 0 gesetzt, ist nach dem nächsten Neustart des Roboter-Interface die entsprechende Knotenadresse im Bereich 1 bis 63 eingestellt.

Eine zuvor von einem Konfigurations-Tool eingestellte KnotenAdresse wird überschrieben.

HINWEIS!

Wurden bereits Einstellungen vorgenommen gibt es 2 Arten um alle Netzwerk-Einstellungen auf Auslieferungszustand zurückzusetzen:

- Alle DIP-Schalter wieder auf 0 setzen und Interface neu starten oder
- Mit dem Button **Restore factory settings** auf der Webseite der Stromquelle


Die Webseite der Stromquelle

Die Stromquelle verfügt über eine eigene Webseite, den SmartManager. Sobald die Stromquelle in einem Netzwerk integriert ist, kann der SmartManager über die IP-Adresse der Stromquelle aufgerufen werden.

Abhängig von Anlagenkonfiguration und Software-Erweiterungen enthält der SmartManager folgende Einträge:

- Übersicht
- Update
- Screenshot
- Sichern & Wiederherstellen
- Funktionspakete
- Job-Daten
- Kennlinienübersicht
- RI FB INSIDE/i

SmartManager der Stromquelle aufrufen und anmelden

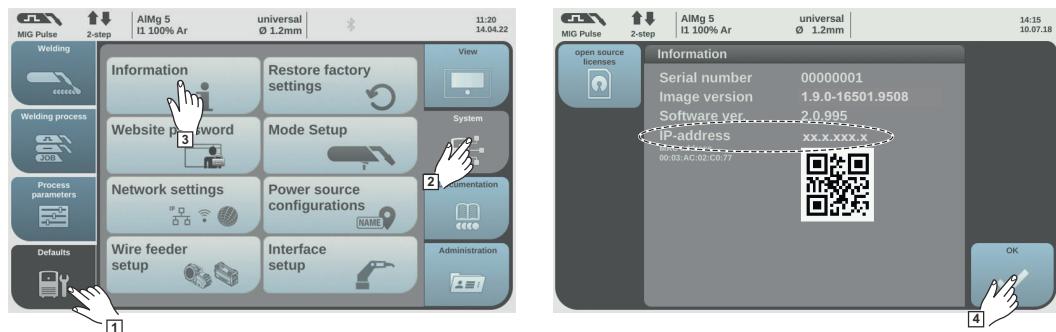

- [1] Voreinstellungen / System / Information ==> IP-Adresse der Stromquelle notieren

2 IP-Adresse im Suchfeld des Browsers eingeben

3 Benutzername und Kennwort eingeben

Werkseinstellung:

Benutzername = admin

Kennwort = admin

4 Angezeigten Hinweis bestätigen

Der SmartManager der Stromquelle wird angezeigt.

Ein- und Ausgangssignale

Datentypen

Folgende Datentypen werden verwendet:

- **UINT16** (Unsigned Integer)
Ganzzahl im Bereich von 0 bis 65535
- **SINT16** (Signed Integer)
Ganzzahl im Bereich von -32768 bis 32767

Umrechnungsbeispiele:

- für positiven Wert (SINT16)
z.B. gewünschter Drahtvorschub x Faktor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dez}} = 04CE_{\text{hex}}$
- für negativen Wert (SINT16)
z.B. gewünschte Lichtbogen-Korrektur x Faktor
 $-6.4 \times 10 = -64_{\text{dez}} = FFC0_{\text{hex}}$

Verfügbarkeit der Eingangssignale

Die nachfolgend angeführten Eingangssignale sind ab Firmware V2.3.0 bei allen Inside/i-Systemen verfügbar.

Eingangssignale (vom Roboter zur Stromquelle)

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut						Standard	Economy		
WORD	BYTE	BIT	BIT								
0	0	0	0	Welding Start	steigend			Siehe Tabelle Wertebereich Working mode auf Seite 16	✓		
		1	1	Robot ready	High						
		2	2	Working mode Bit 0	High						
		3	3	Working mode Bit 1	High						
		4	4	Working mode Bit 2	High						
		5	5	Working mode Bit 3	High						
		6	6	Working mode Bit 4	High						
		7	7	—							
0	1	0	8	Gas on	steigend			Siehe Tabelle Wertebereich Processline selection auf Seite 16	✓		
		1	9	Wire forward	steigend						
		2	10	Wire backward	steigend						
		3	11	Error quit	steigend						
		4	12	Touch sensing	High						
		5	13	Torch blow out	steigend						
		6	14	Processline selection Bit 0	High						
		7	15	Processline selection Bit 1	High						
2	1	0	16	Welding Simulation	High			✓	✓		
		1	17	Synchro pulse on	High						
		2	18	—							
		3	19	—							
		4	20	—							
		5	21	—							
		6	22	Wire brake on	High						
		7	23	Torchbody Xchange	High						
1	3	0	24	—				✓	✓		
		1	25	Teach mode	High						
		2	26	—							
		3	27	—							
		4	28	—							
		5	29	Wire sense start	steigend						
		6	30	Wire sense break	steigend						
		7	31	—							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image				
relativ		absolut						Standard	Economy			
WORD	BYTE	BIT	BIT									
2	4	0	32	TWIN mode Bit 0	High	Siehe Tabelle Wertebereich TWIN mode auf Seite 17	✓	✓				
		1	33	TWIN mode Bit 1	High							
		2	34	—								
		3	35	—								
		4	36	—								
	5	5	37	Documentation mode	High	Siehe Tabelle Wertebereich Documentation mode auf Seite 17						
		6	38	—								
		7	39	—								
		0	40	—								
		1	41	—								
		2	42	—								
		3	43	—								
		4	44	—								
		5	45	—								
		6	46	—								
		7	47	Disable process controlled correction	High							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
7	4	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8	0-7	64-71	Welding characteristic- / Job number	UINT16	0 bis 1000	1	✓	✓
	9	0-7	72-79						
5	10, 11	0-7	80-95	Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG Standard-Manuell, MIG/MAG PMC, MIG/MAG LSC, CMT, ConstantWire: Wire feed speed command value	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
				Beim Job-Betrieb: Power correction		SINT16	-20,00 bis 20,00 [%]	100	

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	absolut					Standard	Economy
6	12, 13	0-7	96-111	Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10	✓	✓
				Beim Schweißverfahren MIG/MAG Standard-Manuell: Welding voltage	UINT16	0,0 bis 6553,5 [V]	10		
				Beim Job-Betrieb: Arclength correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
				Beim Schweißverfahren ConstantWire: Hotwire current	UINT16	0,0 bis 6553,5 [A]	10		
				Beim Schweißverfahren MIG/MAG Puls-Synergic, MIG/MAG Standard-Synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Pulse-/dynamic correction	SINT16	-10,0 bis 10,0 [Schritte]	10		
7	14, 15	0-7	112-127	Beim Schweißverfahren MIG/MAG Standard-Manuell: Dynamic	UINT16	0,0 bis 10,0 [Schritte]	10	✓	✓
				Wire retract correction	UINT16	0,0 bis 10,0 [Schritte]	10		
8	16	0-7	128-135	Welding speed	UINT16	0,0 bis 10,0 [Schritte]	10	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Process controlled correction	UINT16	0,0 bis 1000,0 [cm/min]	10	✓	
	19	0-7	152-159						
10	20	0-7	160-167	Siehe Tabelle Wertebereich Process control-led correction auf Seite 17			✓		
	21	0-7	168-175						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
WORD	BYTE	BIT	BIT					Standard	Economy
11	22	0-7	176-183	—				✓	
	23	0-7	184-191						
12	24	0-7	192-199	—				✓	
	25	0-7	200-207						
13	26	0-7	208-215	—				✓	
	27	0-7	216-223						
14	28	0-7	224-231	—				✓	
	29	0-7	232-239						
15	30	0-7	240-247	Wire forward / backward length	UINT16	OFF / 1 bis 65535 [mm]	1	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire sense edge detection	UINT16	OFF / 0,5 bis 20,0 [mm]	10	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—				✓	
	35	0-7	280-287						
18	36	0-7	288-295	—				✓	
	37	0-7	296-303						
19	38	0-7	304-311	Seam number	UINT16	0 bis 65535	1	✓	
	39	0-7	312-319						

**Wertebereich
Working mode**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	Parameteranwahl intern
0	0	0	0	1	Kennlinien Betrieb Sonder 2-Takt
0	0	0	1	0	Job-Betrieb
0	1	0	0	0	Kennlinien Betrieb 2-Takt
0	1	0	0	1	MIG/MAG Standard-Manuell 2-Takt
1	0	0	0	1	Kühlmittel-Pumpe stoppen

Wertebereich Betriebsart

**Wertebereich
Processline selection**

Bit 1	Bit 0	Beschreibung
0	0	Prozesslinie 1 (default)
0	1	Prozesslinie 2
1	0	Prozesslinie 3

Bit 1	Bit 0	Beschreibung
1	1	Reserviert

Wertebereich Prozesslinien-Auswahl

Wertebereich TWIN mode

Bit 1	Bit 0	Beschreibung
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserve

Wertebereich TWIN-Betriebsart

Wertebereich Documentation mode

Bit 0	Beschreibung
0	Nahtnummer von Stromquelle (intern)
1	Nahtnummer von Roboter (Word 19)

Wertebereich Dokumentationsmodus

Wertebereich Process control- led correction

Prozess	Signal	Aktivität / Datentyp	Wertebereich Einstellbereich	Einheit	Faktor
PMC	Arc length stabilizer	SINT16	-327,8 bis +327,7 0,0 bis +5,0	Volt	10

Wertebereich prozessabhängige Korrektur

Verfügbarkeit der Ausgangssignale	Die nachfolgenden angeführten Ausgangssignale sind ab Firmware V2.3.0 bei allen Inside/i-Systemen verfügbar.
--	--

**Ausgangssignale
(von der Stromquelle zum Roboter)**

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz			
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
0	1	0	8	Collisionbox active	Low	O = Kollision oder Kabelbruch		✓	✓
		1	9	Robot Motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	—					
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection internally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image			
relativ		absolut						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	—							
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	Siehe Tabelle Zuordnung Sensorstatus 1-4 auf Seite 21					
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	—							
		1	33	—							
		2	34	—							
		3	35	Safety status Bit 0	High	Siehe Tabelle Wertebereich Safety status auf Seite 21					
		4	36	Safety status Bit 1	High						
	5	5	37	—							
		6	38	Notification	High						
		7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	—							

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	Process Bit 0	High	Siehe Tabelle Wer-tebereich Process Bit auf Seite 22		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High			✓	✓
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8	0-7	64-71	Welding voltage	UINT16	0,0 bis 655,35 [V]	100	✓	✓
	9	0-7	72-79						
5	10	0-7	80-87	Welding current	UINT16	0,0 bis 6553,5 [A]	10	✓	✓
	11	0-7	88-95						
6	12	0-7	96-103	Wire feed speed	SINT16	-327,68 bis 327,67 [m/min]	100	✓	✓
	13	0-7	104-111						
7	14	0-7	112-119	Actual real value for seam tracking	UINT16	0 bis 6,5535	10000	✓	✓
	15	0-7	120-127						
8	16	0-7	128-135	Error number	UINT16	0 bis 65535	1	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Warning number	UINT16	0 bis 65535	1	✓	
	19	0-7	152-159						

Adresse				Signal	Aktivität / Datentyp	Bereich	Faktor	Prozess-Image	
relativ		absolut						Standard	Economy
10	20	0-7	160-167	Motor current M1	SINT16	-327,68 bis 327,67 [A]	100	✓	
	21	0-7	168-175						
11	22	0-7	176-183	Motor current M2	SINT16	-327,68 bis 327,67 [A]	100	✓	
	23	0-7	184-191						
12	24	0-7	192-199	Motor current M3	SINT16	-327,68 bis 327,67 [A]	100	✓	
	25	0-7	200-207						
13	26	0-7	208-215	—	—	—	—	✓	
	27	0-7	216-223						
14	28	0-7	224-231	—	—	—	—	✓	
	29	0-7	232-239						
15	30	0-7	240-247	—	—	—	—	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire position	SINT16	-327,68 bis 327,67 [mm]	100	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—	—	—	—	✓	
	35	0-7	280-287						
18	36	0-7	288-295	—	—	—	—	✓	
	37	0-7	296-303						
19	38	0-7	304-311	—	—	—	—	✓	
	39	0-7	312-319						

Zuordnung Sensorstatus 1-4

Signal	Beschreibung
Sensor status 1	OPT/i WF R Drahtende (4,100,869)
Sensor status 2	OPT/i WF R Drahtfass (4,100,879)
Sensor status 3	OPT/i WF R Ringsensor (4,100,878)
Sensor status 4	Drahtpufferset CMT TPS/i (4,001,763)

Wertebereich Safety status

Bit 1	Bit 0	Beschreibung
0	0	Reserve
0	1	Halt
1	0	Stopp

Bit 1	Bit 0	Beschreibung
1	1	Nicht eingebaut / aktiv

**Wertebereich
Process Bit**

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Beschreibung
0	0	0	0	0	kein Prozess oder Parameteranwahl intern
0	0	0	0	1	MIG/MAG Puls-Synergic
0	0	0	1	0	MIG/MAG Standard-Synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG Standard-Manuell
0	0	1	1	0	Elektrode
0	0	1	1	1	WIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire

Table of contents

General.....	24
Safety	24
Connections and indicators.....	24
Data Transfer Properties.....	25
Configuration Parameters.....	26
Configuration of robot interface.....	27
Dip switch function.....	27
Configuration of the process data width	27
Set node address with dip switch(example).....	27
Configuring the Node Address.....	29
The Website of the Power Source	29
Opening and Logging into the SmartManager for the Power Source.....	29
Input and output signals.....	31
Data types	31
Availability of Input Signals.....	31
Input Signals (From Robot to Power Source).....	31
Value Range for Working Mode	37
Value range Process line selection	37
Value Range for TWIN Mode.....	38
Value Range for Documentation Mode.....	38
Value range for Process controlled correction.....	38
Availability of Output Signals.....	39
Output Signals (from Power Source to Robot)	39
Assignment of Sensor Statuses 1–4	42
Value range Safety status.....	42
Value Range for Process Bit.....	43

General

Safety




WARNING!

Incorrect operation and faulty work can cause serious personal injury and material damage.

All work and functions described in this document must be performed only by trained specialist personnel who have read and understood the following documents in full:

- ▶ this document
- ▶ the Operating Instructions of the robot interface "RI FB Inside/i"
- ▶ all documents relating to system components, especially the safety rules

Connections and indicators

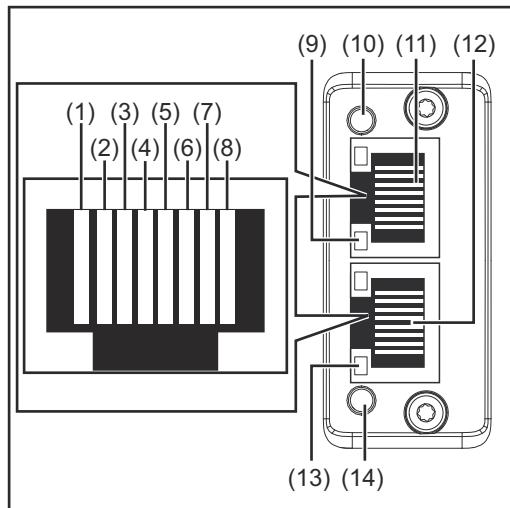

(1)	TX+
(2)	TX-
(3)	RX+
(6)	RX-
(4)	Not normally used; to ensure signal completeness, these pins must be interconnected and, after passing through a filter circuit, must terminate at the ground conductor (PE).
(5)	
(7)	
(8)	
(9)	Connection/activity at connection 2 LED
(10)	LED Error (network status)

(11)	RJ45 connection 2
(12)	RJ45 connection 1
(13)	Connection/activity at connection 1 LED
(14)	LED Status (module status)

LED Status (module status)

Status	Meaning
Off	Not initialized / not active
Flashes green quickly	NMT_CS_BASIC_ETHERNET No data traffic
Flashes green (once)	NMT_CS_PRE_OPERATIONAL_1 Asynchronous data only
Flashes green (twice)	NMT_CS_PRE_OPERATIONAL_2 Asynchronous and synchronous data. No PDO data: all process data are invalid. Received data are ignored.

LED Status (module status)	
Status	Meaning
Flashes green (three times)	NMT_CS_READY_TO_OPERATE Ready for operation. Asynchronous and synchronous data. No PDO data: all process data are invalid. Received data are ignored.
Lights up green	NMT_CS_OPERATIONAL Normal operation. Asynchronous and synchronous data. PDO data are received and sent.
Flashes green slowly	NMT_CS_STOPPED Module stopped (for example, for decommissioning) Asynchronous and synchronous data. No PDO data: all process data are invalid. Received data are ignored.
Lights up red	Exception state, serious fault, etc.

LED Error (network status)	
Status	Meaning
Off	No error
Lights up red	Exception state, serious fault, etc.
Lights up	Error

Connection/activityLED	
Status	Meaning
Off	No connection
Lights up red	Connection established, no data traffic
Lights up	Connection established, data traffic present

Data Transfer Properties

Transmission technology

Ethernet

Medium

When selecting the cable, plug and termination resistances, the Powerlink assembly guideline for the planning and installation of Powerlink systems must be observed.

Transmission speed

100 Mbit/s, Half-Duplex-Mode

Bus connection

2 x Ethernet Powerlink ports (RJ45)

Application Layer


CANopen

Configuration Parameters In some robot control systems, it may be necessary to state the configuration parameters described here so that the bus module can communicate with the robot.

Parameter	Value
Vendor ID	000002C1 _{hex}
Product Code	0x00010301 _{hex} (Economy image) 0x00010302 _{hex} (Standard image)
Manufacturer Device Name	Fronius FB-INSIDE-PowerLink

Configuration of robot interface

Dip switch function

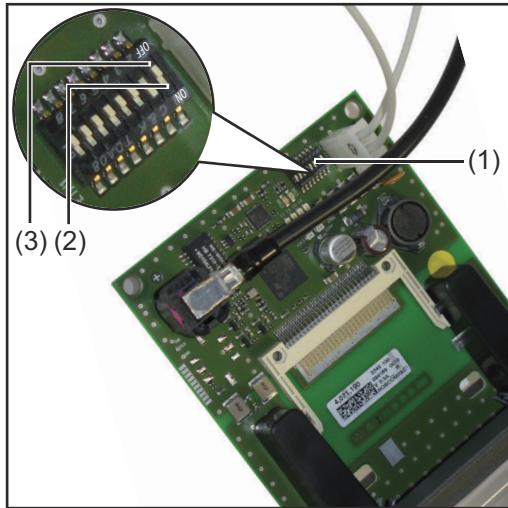

The dip switch (1) on the robot interface RI FB Inside/i is used to configure

- the process data width
- the node address/IP address

At the factory all positions of the dip switch are set to OFF (3).

This corresponds to the binary value 0.

The position (2) corresponds to the binary value 1.

Configuration of the process data width

Dip switch								Configuration
8	7	6	5	4	3	2	1	
OFF	OFF	-	-	-	-	-	-	Standard image 320 Bit
OFF	ON	-	-	-	-	-	-	Economy image 128 Bit
ON	OFF	-	-	-	-	-	-	Not used
ON	ON	-	-	-	-	-	-	Not used

The process data width defines the scope of the transferred data volume.

The kind of data volume that can be transferred depends on

- the robot controls
- the number of power sources

Set node address with dip switch (example)

Dip switch								Node address
8	7	6	5	4	3	2	1	
-	-	OFF	OFF	OFF	OFF	OFF	ON	1
-	-	OFF	OFF	OFF	OFF	ON	OFF	2
-	-	OFF	OFF	OFF	OFF	ON	ON	3
-	-	ON	ON	ON	ON	ON	OFF	62
-	-	ON	ON	ON	ON	ON	ON	63

The node address is set with positions 1 to 6 of the dip switch.

The configuration is carried out in binary format. This results in a configuration range of 1 to 63 in decimal format

NOTE!

After every change of the configurations of the dip switch settings, the interface needs to be restarted so that the changes will take effect.

(Restart = interrupting and restoring the power supply
or executing the relevant function on the website of the power source)

Configuring the Node Address

Upon delivery the configured node address is 0. The node address can be configured in two ways:

- Node addresses in the range of 1 to 63 can be configured with the dip switch.
- If node address 0 is kept on the dip switch, the node addresses in the range of 1 to 125 can only be configured with the following configuration tools:
 - the website of the power source

NOTE!

If the node address is set to higher than 0 with the dip switch, the relevant node address will be configured to the range of 1 to 63 after restarting the robot interface.

A node address previously configured by a configuration tool is overwritten.

NOTE!

If configurations have already been made, the network configurations can be restored to factory settings in two ways:

- set all dip switches back to 0 and restart interface
or
- with the button **Restore factory settings** on the website of the power source

The Website of the Power Source


The power source has its own website, the SmartManager.

As soon as the power source has been integrated into a network, the SmartManager can be opened via the IP address of the power source.

Depending on the system configuration and software upgrades, the SmartManager may contain the following entries:

- Overview
- Update
- Screenshot
- Save and restore
- Function packages
- Job data
- Overview of characteristics
- **RI FB INSIDE/i**

Opening and Logging into the SmartManager for the Power Source

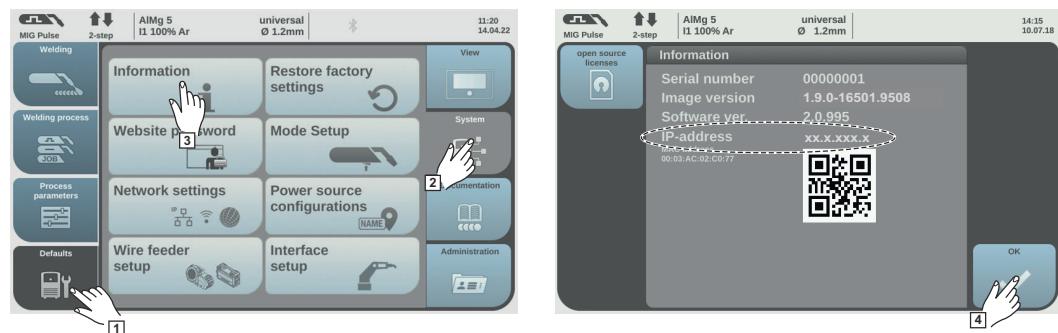

[1] Presettings/System/Information ==> note down IP address of power source

[2] Enter the IP address into the search field of the browser

3 Enter username and password

Factory setting:
Username = admin
Password = admin

4 Confirm displayed message

The SmartManager of the power source is displayed.

Input and output signals

Data types

The following data types are used:

- **UINT16** (Unsigned Integer)
Whole number in the range from 0 to 65535
- **SINT16** (Signed Integer)
Whole number in the range from -32768 to 32767

Conversion examples:

- for a positive value (SINT16)
e.g. desired wire speed x factor
 $12.3 \text{ m/min} \times 100 = 1230_{\text{dec}} = 04CE_{\text{hex}}$
- for a negative value (SINT16)
e.g. arc correction x factor
 $-6.4 \times 10 = -64_{\text{dec}} = FFC0_{\text{hex}}$

Availability of Input Signals

The input signals listed below are available from firmware V2.3.0 for all Inside/i systems.

Input Signals (From Robot to Power Source)

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Welding Start	Increasing			See table Value Range for Working Mode on page 37	✓ ✓
		1	1	Robot ready	High				
		2	2	Working mode Bit 0	High				
		3	3	Working mode Bit 1	High				
		4	4	Working mode Bit 2	High				
		5	5	Working mode Bit 3	High				
		6	6	Working mode Bit 4	High				
		7	7	—					
0	1	0	8	Gas on	Increasing			See table Value range Process line selection on page 37	✓ ✓
		1	9	Wire forward	Increasing				
		2	10	Wire backward	Increasing				
		3	11	Error quit	Increasing				
		4	12	Touch sensing	High				
		5	13	Torch blow out	Increasing				
		6	14	Process line selection Bit 0	High				
		7	15	Process line selection Bit 1	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
2	1	0	16	Welding Simulation	High			✓	✓
		1	17	Synchro pulse on	High				
		2	18	—					
		3	19	—					
		4	20	—					
		5	21	—					
		6	22	Wire brake on	High				
		7	23	Torchbody Xchange	High				
1	3	0	24	—				✓	✓
		1	25	Teach mode	High				
		2	26	—					
		3	27	—					
		4	28	—					
		5	29	Wire sense start	Increasing				
		6	30	Wire sense break	Increasing				
		7	31	—					

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
2	4	0	32	TWIN mode Bit 0	High	See table Value Range for TWIN Mode on page 38	✓	✓	
		1	33	TWIN mode Bit 1	High				
		2	34	—					
		3	35	—					
		4	36	—					
	5	5	37	Documentation mode	High	See table Value Range for Documentation Mode on page 38			
		6	38	—					
		7	39	—					
		0	40	—					
		1	41	—					
		2	42	—					
		3	43	—					
		4	44	—					
		5	45	—					
		6	46	—					
		7	47	Disable process controlled correction	High				

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	—				✓	✓
		1	49	—					
		2	50	—					
		3	51	—					
		4	52	—					
		5	53	—					
		6	54	—					
		7	55	—					
7	4	0	56	ExtInput1 => OPT_Output 1	High			✓	✓
		1	57	ExtInput2 => OPT_Output 2	High				
		2	58	ExtInput3 => OPT_Output 3	High				
		3	59	ExtInput4 => OPT_Output 4	High				
		4	60	ExtInput5 => OPT_Output 5	High				
		5	61	ExtInput6 => OPT_Output 6	High				
		6	62	ExtInput7 => OPT_Output 7	High				
		7	63	ExtInput8 => OPT_Output 8	High				
4	8	0-7	64-71	Welding characteristic- / Job number	UINT16	0 to 1000	1	✓	✓
	9	0-7	72-79						
5	10, 11	0-7	80-95	<p>With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG standard manual, MIG/MAG PMC, MIG/MAG LSC, CMT, ConstantWire:</p> <p>Wire feed speed command value</p> <p>With the Job mode:</p> <p>Power correction</p>	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	12, 13	0-7	96-111	With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Arclength correction	SINT16	-10.0 to 10.0 [Steps]	10	✓	✓
				With the welding process MIG/MAG standard manual: Welding voltage	UINT16	0.0 to 6553.5 [V]	10		
				With the Job mode: Arclength correction	SINT16	-10.0 to 10.0 [Steps]	10		
				With the welding process ConstantWire: Hotwire current	UINT16	0.0 to 6553.5 [A]	10		
				With the welding process MIG/MAG pulse synergic, MIG/MAG standard synergic, MIG/MAG PMC, MIG/MAG LSC, CMT: Pulse-/dynamic correction	SINT16	-10.0 to 10.0 [Steps]	10		
7	14, 15	0-7	112-127	With the welding process MIG/MAG standard manual: Dynamic	UINT16	0.0 to 10.0 [Steps]	10	✓	✓
				Wire retract correction	UINT16	0.0 to 10.0 [Steps]	10		
8	16	0-7	128-135	Welding speed	UINT16	0.0 to 1000.0 [cm/min]	10	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Process controlled correction		See table Value range for Process controlled correction on page 38	10	✓	
	19	0-7	152-159						
10	20	0-7	160-167					✓	
	21	0-7	168-175						
11	22	0-7	176-183	—				✓	
	23	0-7	184-191						

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
12	24	0-7	192-199	—				✓	
	25	0-7	200-207						
13	26	0-7	208-215	—				✓	
	27	0-7	216-223						
14	28	0-7	224-231	—				✓	
	29	0-7	232-239						
15	30	0-7	240-247	Wire forward / backward length	UINT16	OFF / 1 to 65535 [mm]	1	✓	
	31	0-7	248-255						
16	32	0-7	256-263	Wire sense edge detection	UINT16	OFF / 0.5 to 20.0 [mm]	10	✓	
	33	0-7	264-271						
17	34	0-7	272-279	—				✓	
	35	0-7	280-287						
18	36	0-7	288-295	—				✓	
	37	0-7	296-303						
19	38	0-7	304-311	Seam number	UINT16	0 to 65535	1	✓	
	39	0-7	312-319						

Value Range for Working Mode

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	Internal parameter selection
0	0	0	0	1	Special 2-step mode characteristics
0	0	0	1	0	Job mode
0	1	0	0	0	2-step mode characteristics
0	1	0	0	1	2-step MIG/MAG standard manual
1	0	0	0	1	Stop coolant pump

Value range for operating mode

Value range Process line selection

Bit 1	Bit 0	Description
0	0	Process line 1 (default)
0	1	Process line 2
1	0	Process line 3
1	1	Reserved

Value range for process line selection

Value Range for TWIN Mode

Bit 1	Bit 0	Description
0	0	TWIN Single mode
0	1	TWIN Lead mode
1	0	TWIN Trail mode
1	1	Reserved

Value range for TWIN mode

Value Range for Documentation Mode

Bit 0	Description
0	Seam number of power source (internal)
1	Seam number of robot (Word 19)

Value range for documentation mode

Value range for Process controlled correction

Process	Signal	Activity / Data type	Value range configuration range	Unit	Factor
PMC	Arc length stabilizer	SINT16	-327.8 to +327.7 0.0 to +5.0	Volts	10

Value range for process-dependent correction

Availability of Output Signals	The output signals listed below are available from firmware V2.3.0 for all Inside/i systems.
---------------------------------------	--

Output Signals (from Power Source to Robot)

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
0	0	0	0	Heartbeat Powersource	High/Low	1 Hz		✓	✓
		1	1	Power source ready	High				
		2	2	Warning	High				
		3	3	Process active	High				
		4	4	Current flow	High				
		5	5	Arc stable- / touch signal	High				
		6	6	Main current signal	High				
		7	7	Touch signal	High				
0	1	0	8	Collisionbox active	Low	O = collision or cable break		✓	✓
		1	9	Robot Motion Release	High				
		2	10	Wire stick workpiece	High				
		3	11	—					
		4	12	Short circuit contact tip	High				
		5	13	Parameter selection internally	High				
		6	14	Characteristic number valid	High				
		7	15	Torch body gripped	High				

Address				Signal	Activity / data type	Range	Factor	Process image			
relative		absolute						Standard	Economy		
WORD	BYTE	BIT	BIT								
1	2	0	16	Command value out of range	High			✓	✓		
		1	17	Correction out of range	High						
		2	18	—							
		3	19	Limitsignal	High						
		4	20	—							
		5	21	—							
		6	22	Main supply status	Low						
	3	7	23	—							
		0	24	Sensor status 1	High	See table Assignment of Sensor Statuses 1–4 on page 42					
		1	25	Sensor status 2	High						
		2	26	Sensor status 3	High						
		3	27	Sensor status 4	High						
		4	28	—							
		5	29	—							
2	4	6	30	—				✓	✓		
		7	31	—							
		0	32	—							
		1	33	—							
		2	34	—							
		3	35	Safety status Bit 0	High	See table Value range Safety status on page 42					
		4	36	Safety status Bit 1	High						
		5	37	—							
		6	38	Notification	High						
	5	7	39	System not ready	High						
		0	40	—							
		1	41	—							
		2	42	—							
		3	43	—							
		4	44	—							
		5	45	—							
		6	46	—							
		7	47	—							

Address				Signal	Activity / data type	Range	Factor	Process image	
relative		absolute						Standard	Economy
WORD	BYTE	BIT	BIT						
6	3	0	48	Process Bit 0	High	See table Value Range for Process Bit on page 43		✓	✓
		1	49	Process Bit 1	High				
		2	50	Process Bit 2	High				
		3	51	Process Bit 3	High				
		4	52	Process Bit 4	High				
		5	53	—					
		6	54	Touch signal gas nozzle	High				
		7	55	TWIN synchronization active	High				
7	3	0	56	ExtOutput1 <= OPT_Input1	High			✓	✓
		1	57	ExtOutput2 <= OPT_Input2	High				
		2	58	ExtOutput3 <= OPT_Input3	High				
		3	59	ExtOutput4 <= OPT_Input4	High				
		4	60	ExtOutput5 <= OPT_Input5	High				
		5	61	ExtOutput6 <= OPT_Input6	High				
		6	62	ExtOutput7 <= OPT_Input7	High				
		7	63	ExtOutput8 <= OPT_Input8	High				
4	8	0-7	64-71	Welding voltage	UINT16	0.0 to 655.35 [V]	100	✓	✓
	9	0-7	72-79						
5	10	0-7	80-87	Welding current	UINT16	0.0 to 6553.5 [A]	10	✓	✓
	11	0-7	88-95						
6	12	0-7	96-103	Wire feed speed	SINT16	-327.68 to 327.67 [m/min]	100	✓	✓
	13	0-7	104-111						
7	14	0-7	112-119	Actual real value for seam tracking	UINT16	0 to 6.5535	10000	✓	✓
	15	0-7	120-127						
8	16	0-7	128-135	Error number	UINT16	0 to 65535	1	✓	
	17	0-7	136-143						
9	18	0-7	144-151	Warning number	UINT16	0 to 65535	1	✓	
	19	0-7	152-159						

Address				Signal	Activity / data type	Range	Factor	Process image					
relative		absolute						Standard	Economy				
WORD	BYTE	BIT	BIT										
10	20	0-7	160-167	Motor current M1	SINT16	-327.68 to 327.67 [A]	100	✓					
	21	0-7	168-175										
11	22	0-7	176-183	Motor current M2	SINT16	-327.68 to 327.67 [A]	100	✓					
	23	0-7	184-191										
12	24	0-7	192-199	Motor current M3	SINT16	-327.68 to 327.67 [A]	100	✓					
	25	0-7	200-207										
13	26	0-7	208-215	—	—	—	—	✓					
	27	0-7	216-223										
14	28	0-7	224-231	—	—	—	—	✓					
	29	0-7	232-239										
15	30	0-7	240-247	—	—	—	—	✓					
	31	0-7	248-255										
16	32	0-7	256-263	Wire position	SINT16	-327.68 to 327.67 [mm]	100	✓					
	33	0-7	264-271										
17	34	0-7	272-279	—	—	—	—	✓					
	35	0-7	280-287										
18	36	0-7	288-295	—	—	—	—	✓					
	37	0-7	296-303										
19	38	0-7	304-311	—	—	—	—	✓					
	39	0-7	312-319										

Assignment of Sensor Statuses 1–4

Signal	Description
Sensor status 1	OPT/i WF R wire end (4,100,869)
Sensor status 2	OPT/i WF R wire drum (4,100,879)
Sensor status 3	OPT/i WF R ring sensor (4,100,878)
Sensor status 4	Wire buffer set CMT TPS/i (4,001,763)

Value range Safety status

Bit 1	Bit 0	Description
0	0	Reserve
0	1	Hold
1	0	Stop
1	1	Not installed / active

Value Range for Process Bit

Bit 4	Bit 3	Bit 2	Bit 1	Bit 0	Description
0	0	0	0	0	No internal parameter selection or process
0	0	0	0	1	MIG/MAG pulse synergic
0	0	0	1	0	MIG/MAG standard synergic
0	0	0	1	1	MIG/MAG PMC
0	0	1	0	0	MIG/MAG LSC
0	0	1	0	1	MIG/MAG standard manual
0	0	1	1	0	Electrode
0	0	1	1	1	TIG
0	1	0	0	0	CMT
0	1	0	0	1	ConstantWire



 SPAREPARTS
ONLINE

Fronius International GmbH

Froniusstraße 1
4643 Pettenbach
Austria
contact@fronius.com
www.fronius.com

Under www.fronius.com/contact you will find the addresses
of all Fronius Sales & Service Partners and locations.